

### **SM300 Exhaust Manifold Adaption**

TSB-16-001

Date: December 5, 2016 Model: SM300

#### **Product Improvement:**

Laymor has determined that some of the sweepers may be subjected to excessive vibrations resulting in exhaust manifold breakage. This TSB will be fix on fail.

#### Units associated:

SM300 units delivered between the dates of March 1, 2014 through September, 2016.

#### Parts needed: Kit: 1000195K

- 1 EA. 1000194 Exhaust Downpipe
- 1 EA. 9107103 Exhaust Manifold
- 1 EA. 9107104 Exhaust Manifold Gasket
- 1 EA. 1000193 Muffler Bracket
- 1 EA. 9101778 Exhaust Gasket
- 1 EA. 100176 Muffler Clamp
- 4 EA. 011322 Washer

#### Approved SRT:

The Laymor approved standard repair time for this service bulletin is 1.5 hours.






#### Tools needed:

- SAE socket set ¼" to 1"
- SAE wrench set 5/16" to 1"
- 1/4" drive Ratchet
- 6 MM Hex bit or Allen head socket (exhaust bolts)
- 3/8" drive ratchet or impact wrench
- 17 MM socket (motor mount bolts)
- Torque wrench up to 50 Ft. Lbs. (motor mount bolts)
- Dead blow hammer
- Thread locker / Loctite

#### **Instructions:**

1. Start by removing the lower exhaust hanger strap located below the right side of the radiator. Discard strap.

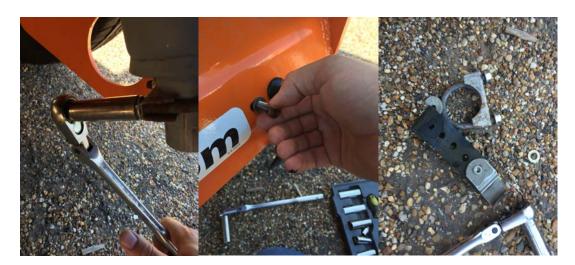





2. Next remove the exhaust down pipe bolts (4 ea.)



3. Remove existing exhaust manifold downpipe and remove muffler. Discard downpipe.





4. Remove the top two right rear motor mount bolts.



5. Attach muffler support bracket onto the right rear motor mount. Apply thread locker to both bolts and torque to 50 Ft. Lbs. using the 17 MM socket.







7. Install muffler to down pipe. Install muffler to assembly to new muffler mount bracket.







8. Install exhaust muffler U-bolt clamp and leave slightly loose. Install muffler down pipe assembly to exhaust manifold. Torque manifold bolts to? Tighten the U-bolt clamp to?









#### **REVISION HISTORY**

**REVISION DESCRIPTION OF CHANGE** DATE

NEW 12/5/2016 NEW PROCEDURE

APPROVALS	AUTHOR	DATE
Design Engineer	David Sandgren	12/5/2016
Director of Engineer	Andy Cooper	12/5/2016
Director of Quality	Barbara McCullough	12/5/2016

